



INSPECTION DEPARTMENT
Billet Survey Main Span (East)
DATE. 2014.09.16.

Main Span: North East

PP 48 - Remains in a satisfactory condition.

PP 50 - **Staging in place, works to be carried out.**

PP 52 - Remains in a satisfactory condition.

PP 54 - Half joint packers missing on stringers No 1 & 3, heavy wear – down on Nos, 2 & 4. **Noisy , requires to be done.**

PP 56 - Remains in a satisfactory condition.

PP 58 - Hardox packers installed, billets painted. **Staging at this location.**

PP 60 - Half joint packers missing on billet No 1. Stringers No 2, 3 & 4 . wear-down on packers evident. **Noisy , requires to be done.**

PP 62 - Remains in a satisfactory condition.

PP 64 - Remains in a satisfactory condition.

PP 66 - Wear – down on packers No 1,2,3 & 4 . Half joint No 2. **Noisy , requires to be done.**

PP 68 - Remains in a satisfactory condition.

PP 70 - Half joint packer missing on billet No 1. Stringers No 2, 3 & 4 . wear-down on packers evident. **Noisy , requires to be done.**

PP 72 - Half joint packer missing on billet No 1. Stringers No 2, 3 & 4 . wear-down on packers evident. **Noisy , requires to be done.**

PP 74 - Remains in a satisfactory condition.

PP 76 - Half joint packer missing on billet No3, Stringers No. 1,2 & 4.wear-down evident . **Noisy , requires to be done.**

PP 78 - Wear – down on half joint packers No. 3 & 4. Remains in a satisfactory condition at time of inspection.

PP 80 - Remains in a satisfactory condition.

PP 82 - Remains in a satisfactory condition.

PP 84 - Remains in a satisfactory condition.

PP 86 - Wear – down on half joint packers Nos, 1,2,3 & 4. **Noisy , requires to be done.**



INSPECTION DEPARTMENT
Billet Survey Main Span (East)
DATE. 2014.09.16.

PP 88 - Remains in a satisfactory condition.

PP 90 - Remains in a satisfactory condition.

PP 92 - Half joint packers missing on stringers No 1,2 & 3, wear – down on stringer No 4.
Noisy , requires to be done.

PP 94 - Wear – down on half joint packers Nos, 1,2,3 & 4. Half joint No 2. **Noisy , requires to be done.**

PP 96 - Remains in a satisfactory condition.

PP 98 - Half joint packers missing on stringers No 1,2 & 3 & No 4. **Noisy , requires to be done.**

PP 100 - Half joint packer missing on stringer No 1. Wear – down on packers on stringers Nos, 2,3 & 4. **Will monitor.**

Main Span: South East.

PP 48 - Half joint packer missing on stringer No 1. Wear – down on packers on stringers Nos, 2,3 & 4. **requires to be done.**

PP 50 - Remains in a satisfactory condition.

PP 52 - Remains in a satisfactory condition.

PP 54 - Remains in a satisfactory condition.

PP 56 - Remains in a satisfactory condition.

PP 58 - Half joint packer missing on stringer Nos . 2 & 3, Wear – down on packers on stringers Nos, 1 & 4. Heavy deck panel movement , **requires to be done.**

PP 60 - Slight wear – down half joint packers Nos 1 & 4. remains in a satisfactory condition.

PP 62 - Remains in a satisfactory condition.

PP 64 - Wear – down on all half joints. **Will monitor.**

PP 66 - Hardox packers installed, billets painted. **Staging at this location.**

PP 68 - Slight wear – down on half joint packers No 1 & 2. Remains in a satisfactory condition.

PP 70 - Hardox packers installed, billets painted. Remains in a satisfactory condition.

G:\dd\t&p\rmmd\branch8\FRB FOI\2. Inspection Records - Main Cable, Cable Anchorages\FETA inspection records for Suspended Span - FOI - Sheena\Mainspan\Independent Inspections\Billet survey. September 2014\Billet Survey - East Main Span 2014.09.16..doc



INSPECTION DEPARTMENT
Billet Survey Main Span (East)
DATE. 2014.09.16.

PP 72 - Hardox packers installed, on half joints No 1 & 2. billets painted. Remains in a satisfactory condition.

PP 74 - Half joint packers missing on all stringers. requires to be done. Platform in place to carry out works.

PP 76 - Hardox packers installed, billets painted. Remains in a satisfactory condition. Staging remains.

PP 78 - Half joint packers missing on stringers No 1 & 2 requires to be done.

PP 80 - Wear – down on half joint packers Nos, 1,2,3 & 4. Half joint No 2. Noisy , requires to be done.

PP 82 - Half joint packer missing on stringer No 3. No 1, 2, & 4 ,packer wear-down evident , Will monitor.

PP 84 - Wear – down on half joint packers Nos, 1,2,3 & 4. Half joint No 2. Noisy , requires to be done.

PP 86 - Half joint packer wear-down on Stringer No.1 . remains satisfactory.

PP 88 - Remains in a satisfactory condition.

PP 90 - Half joint packers missing on stringers No 1,2 & 3 packer wear – down on stringer No 4. requires to be done.

PP 92 - Remains in a satisfactory condition.

PP 94 - Remains in a satisfactory condition.

PP 96 - Remains in a satisfactory condition.

PP 98 - Remains in a satisfactory condition.

PP 100 – Half joint packers missing on stringer No 1 & 2. packer wear – down on stringers No 3 & 4. requires to be done.