

Main Cable Inspection. Hand-strand cable clamp / post connections. South Main Span (West)				
Panel point.	Vertical movement. (sleeve wear-down)	Horizontal movement. (washer wear-down)	Washers missing.	Any other defect.
PP.46.	No.	Ok. East & West.	No.	corrosion visible on face of upper cable band bolt heads.
PP.48.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.50.**	Yes. E & W. Bad.	Yes. E & W. Bad.	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.52.**	Yes. E & W. Bad.	Yes. E & W. Bad.	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.54.	No.	Yes.East only.(min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.56.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.58.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.60.	No.	Yes East (min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.62.**	Yes. E & W. Bad.	Yes. E & W. Bad.	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.64.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.66.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.68.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.70.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.72.**	Yes. E & W. Bad.	Yes. E & W. Bad.	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.74.	No.	Yes. E & W.	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.76.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.78.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.80.	(Slight)West	Yes. E & W. (max)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.82.	No.	Yes. East. (min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.84.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.86.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.88.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.90.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.92.	No.	Yes. East. (min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.94.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.96.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.98.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper cable band bolt. (E & W)
PP.100.	No.	Yes. E & W. (min)	No.	Impact damage visible on face of upper & lower cable band bolt. (E & W)
Additional updated information. ***** Temporary hardwood wedges installed at locations highlighted with Asterix following the above inspection. 16/05/07 . Other positions as deemed necessary to be wedged by inspector completed to-day on walk through .No locations taken .				