

Main Cable Inspection. Hand-strand cable clamp / post connections. North Main Span. ( East )				
Panel point.	Vertical movement. ( sleeve wear-down )	Horizontal movement. ( washer wear-down )	Washers missing.	Any other defect.
PP.46.	No.	Ok. East & West.	No.	corrosion visible on face of upper cable band bolt heads.
PP.48.**	Yes. West.	Yes. E & W.(max)	No.	Impact damage visible on face of upper cable band bolt. ( west )
PP.50.	No.	Yes East (min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.52.	No.	Yes West (min)	No.	No.
PP.54.**	Yes. E & W. Bad.	Yes. E & W.(max)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.56.	No.	Yes. E & W.(min)	No.	No.
PP.58.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.60.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.62.	No.	Yes. E & W.(min)	No.	No.
PP.64.**	Yes. West.	Yes East (min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.66.	No.	Yes West (min)	No.	Impact damage visible on face of upper cable band bolt. ( West )
PP.68.**	Yes. West.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.70.**	Yes. East.	Yes. E & W.(max)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.72.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.74.	No.	Yes West (min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.76.	(Slight ) West.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.78.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.80.	No.	Yes East (min)	No.	Small are of paint missing on main cable. Impact as above.
PP.82.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.84.**	Yes. East.	Yes. E & W.(max)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.86.	No.	No.	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.88.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.90.	No.	Yes West (min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.92.	No.	Yes. E & W.(min)	No.	No.
PP.94.	No.	No.	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.96.	Yes. West.	Yes West (min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.98.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. ( East )
PP.100.	No.	Yes East (min)	No.	Impact damage visible on face of upper cable band bolt. ( East )

**Additional updated information.** \*\*\*\*\* Temporary **hardwood** wedges installed at locations highlighted with **Asterix** following the above inspection. **04/06/07.**