

Main Cable Inspection. Hand-strand cable clamp / post connections. South Side Span. (East.)				
Panel point.	Vertical movement. (sleeve wear-down)	Horizontal movement. (washer wear-down)	Washers missing.	Any other defect.
PP.00.	No.	No.	No.	corrosion visible on face of upper cable band bolt heads.
PP.02.	No.	No.	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.04.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.06.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.08.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.10.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.12.	No.	Yes. East (min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.14.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.16.	No.	Yes. E & W.(med)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.18.	No.	No.	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.20.	(Slight) East.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.22.	No.	No.	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.24.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.26.	No.	Yes. East (min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.28.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.30.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.32.**	No.	Yes. East (max)	Yes.	Impact damage visible on face of upper cable band bolt. (east)
PP.34.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.36.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.38.	No.	Yes. East (min)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.40.	No.	Yes. E & W.(max)	No.	Impact damage visible on face of upper cable band bolt. (east)
PP.42.	No.	Yes. E & W.(min)	No.	Impact damage visible on face of upper cable band bolt. (west)
PP.44.	No.	No.	No.	corrosion visible on face of upper cable band bolt heads.
Additional information.: PP. 32. There appears to be no washers evident at this position. Additional updated information. ***** Temporary hardwood wedges installed at locations highlighted with Asterix following the above inspection. 05/06/07.				

