

INSPECTION DATE. : 11/12/08. MAINSPAN (WEST) BANGING BILLET LOCATIONS.

	SOUTH. WEST.		NORTH. WEST.
PP. 48.	SATISFACTORY.	PP. 100.	SATISFACTORY.
PP. 50.	SATISFACTORY.	PP. 98.	BILLET No1 GAP 8-10mm
PP. 52.	BILLETS 1,2,3 & 4. NOISY	PP. 96.	SATISFACTORY.
PP. 54.	BILLETS 1,2,3 & 4. NOISY	PP. 94.	SATISFACTORY.
PP. 56.	SATISFACTORY.	PP. 92.	SATISFACTORY.
PP. 58.	SATISFACTORY.	PP. 90.	SATISFACTORY.
PP. 60.	BILLETS 1,2,3 & 4. NOISY	PP. 88.	SATISFACTORY.
PP. 62.	BILLETS 1,2,3 & 4. NOISY	PP. 86.	Gaps on billets 1,2 & 3. 5mm to
			8mm. billet no 1 chattering.
PP. 64.	SATISFACTORY.	PP. 84.	SATISFACTORY.
PP. 66.	GAPS. 1,2,3 &4 UP TO	PP. 82.	Gaps on billets 2 & 3. 3mm to
	12mm		5mm.
PP. 68.	BILLET 1 NOISY. GAPS	PP. 80.	SATISFACTORY.
	ON BILLETS 1,2,&3.		
	3mmTO 8mm		
PP. 70.	BILLETS 1,2,3 & 4. NOISY	PP. 78.	SATISFACTORY.
PP. 72.	BILLET 2 NOISY	PP. 76.	Billets 2 & 3 gaps 3mm to 8mm
PP. 74.	BILLETS 1,2,3 & 4. NOISY	PP. 74.	BILLET 2 NOISY
PP. 76.	BILLETS 1,2,& 3 NOISY	PP. 72.	SATISFACTORY.
PP. 78.	SATISFACTORY.	PP. 70.	SATISFACTORY.
PP. 80.	BILLETS NOISY	PP. 68.	Billets 2 & 3 gaps 8mm to10mm
PP. 82.	SATISFACTORY. GAP ON	PP. 66.	SATISFACTORY.
	BILLET 10mm		
PP. 84.	SATISFACTORY.	PP. 64.	SATISFACTORY.
PP. 86.	SATISFACTORY.	PP. 62.	SATISFACTORY.
PP. 88.	BILLETS 2 & 3 NOISY	PP. 60.	Billets 1 & 2 gaps 3mm to8mm
PP. 90.	BILLETS 2 & 3 GAPS 3mm	PP. 58.	Billets 1 & 32 gaps 3mm to8mm
	to 8mm		
PP. 92.	BILLETS 1 & 2 NOISY	PP. 56.	Billet No 3. GAP 4mm TO 6MM
PP. 94.	BILLET 1 NOISY	PP. 54.	Billets 2 & 3 GAPS 3mm to
			8mm
PP. 96.	BILLETS 1 & 2 NOISY	PP. 52.	SATISFACTORY.
PP. 98.	SATISFACTORY.	PP. 50.	SATISFACTORY.
PP. 100.	BILLETS 2 & 3 GAPS 3mm	PP. 48.	Billets 2 & 3 GAPS 3mm to
	to 8mm		8mm

*******Priority 1. ******* Priority 2. ******* Priority 3. Information. Although the mating faces between the billet top and stringer soffit have gaps as recorded all remain relatively quiet. It is possible that deck levels may have dropped & packing may be required in these areas.