



P.P.54 N.E.

No.1 STRINGER BEARING PLATE
HAS ONE BOLT SHEARED OR
MISSING.

ACCESS REQUIRED.



P.P.70 N.E.

2nd WALKWAY SUPPORT SOUTH
HAS WEAR BETWEEN STRINGER &
LINDAPTORS, BOTH NORTH &
SOUTH SIDES OF SUPPORT.
NEW LINDAPTORS REQUIRED.



P.P.94 N.E.

GULLY POT LOCATED ON
STRINGER No.1 HAS 4 BOLTS
LOOSE AND THE FOURTH
BEGINNING TO GO.

REPLACE ALL 4 BOLTS.



P.P.94 N.E.

STIFFENER PLATE FROM STRINGER
No.1 TO TROUGH No.1 HAS
CRACKED WELD.

GRIND OUT AND RE-WELD
REQUIRED.