



P.P. 94 S.E.

WALKWAY SPLICE BOLTS.
2 BOLTS LOOSE EAST SIDE OF
WALKWAY.



P.P. 84 S.E.

REDUNDANT TUBE AND
FITTING: REQUIRES REMOVAL.
NOW CAUSING WEAR AT THE
THREE POINTS INDICATED.





P.P. 79 S.E.

BOLT SHEARED ON BEAM 4,
NORTH FACE BOTTOM CLUSTER.



P.P. 74 S.E.

WALKWAY SPLICE BOLTS.
2 BOLTS LOOSE WEST SIDE OF
WALKWAY.



P.P. 64 S.E.

UNDER ANGLE WALKWAY
SUPPORT HAS LOOSE
LINDAPTOR ON EAST SIDE
CAUSING MOVEMENT.



P.P. 60 S.E.

BEAM 7 HAS A SCAFFOLD TUBE
APPROXIMATELY 1 METRE IN
LENGTH.

THIS IS CAUSING WEAR TO WEB.



P.P. 54 S.E.

UNDER ANGLE WALKWAY
SUPPORT HAS LOOSE
LINDAPTORS ON EAST & WEST
SIDES CAUSING MOVEMENT



P.P. 52 S.E.

WALKWAY SPLICE BOLTS LOOSE – 2 EAST & 2 WEST.