



P.P. 97S.E.

WALKWAY SUPPORT, 2 BOLTS
LOOSE. PREVIOUSLY RECORDED
04/09, STILL OUTSTANDING.



P.P. 97S.E.

2ND SUPPORT SOUTH OF PANEL
POINT. SIGNS OF MOVEMENT
VISIBLE, INDICATING BOLTS ARE
BECOMING LOOSE.



P.P. 91S.E.

SUPPORT SOUTH OF PANEL POINT.
SIGNS OF MOVEMENT VISIBLE,
INDICATING BOLTS ARE BECOMING
LOOSE.



P.P. 91S.E.

2nd SUPPORT SOUTH OF PANEL
POINT. SIGNS OF MOVEMENT
VISIBLE, INDICATING BOLTS ARE
BECOMING LOOSE.



P.P. 84S.E.

WEAR VISIBLE FROM POSSIBLY 3
OUT 4 TUBES RUBBING ON
X-GIRDER.

**TUBE & FITTING WILL REQUIRE
REMOVING TO ENABLE ANY
REPAIR.**



P.P. 80S.E.

STIFFENER BETWEEN STRINGER
No.1 AND TROUGH No.1 HAS
CRACKED AROUND NOSE AND IS
LEADING INTO TROUGH APPROX.
25mm.



P.P. 76 S.E.

2nd SUPPORT SOUTH OF PANEL
POINT, HAS 2 LOOSE BOLTS.



P.P. 83 S.E.

STRINGER No. 1 BEARING PLATE HAS
SHEARED BOLT (NORTH INNER).
REQUIRES REPLACING.

ACCESS REQUIRED.



P.P. 56-57 S.E.

WALKWAY SUPPORT, ONE BOLT
LOOSE SECOND BOLT SHOWS
SIGNS OF MOVEMENT.



P.P. 50-51 S.E.

WALKWAY SUPPORT, LINDAPTORS
NORTH AND SOUTH SIDES OF
SUPPORT LOOSE.