




INSPECTION DEPARTMENT
Main span North East. Crash barrier / Handrail.
DATE. 2015.01.21

MAIN SPAN NORTH (EAST)

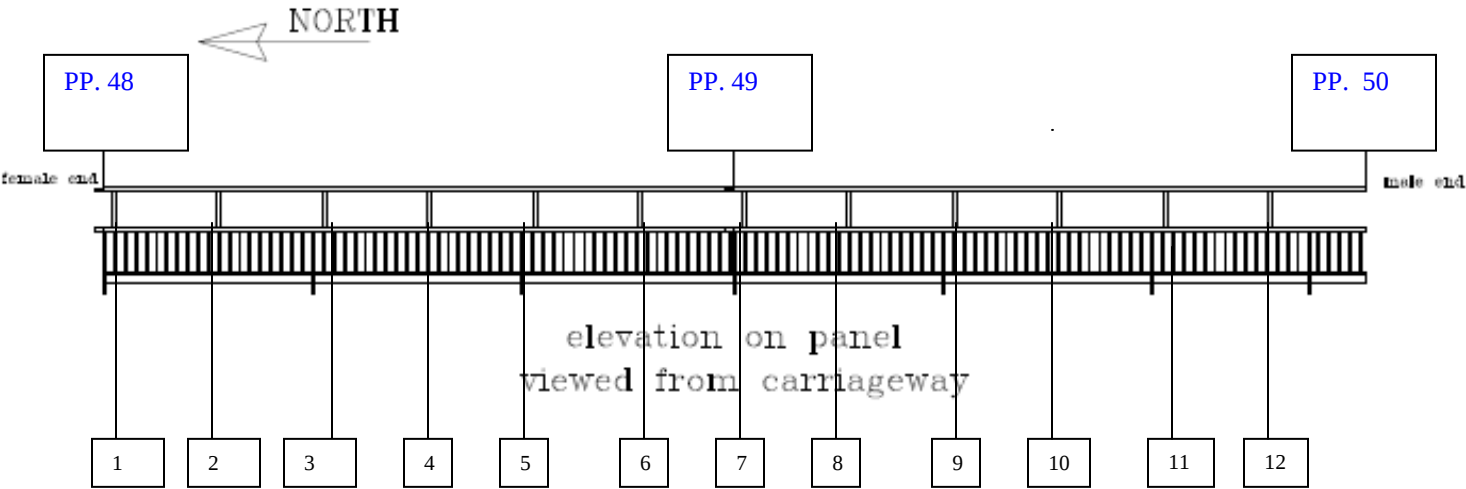

Relevant information:

Top Rail. - New top rail joint detail – bolt pulled through at PP48 and plate washer for bolt required at PP50

- Post No1.-
- Post No2.-
- Post No3.-
- Post No4.-
- Post No5.-
- Post No6.-
- Post No7.-
- Post No8.-
- Post No9.-
- Post No10.-
- Post No11.-
- Post No12.-
- Bottom Rail.-
- Grillage.-




INSPECTION DEPARTMENT

Main span North East. Crash
barrier / Handrail.

DATE. 2015.01.21

MAIN SPAN NORTH (EAST)

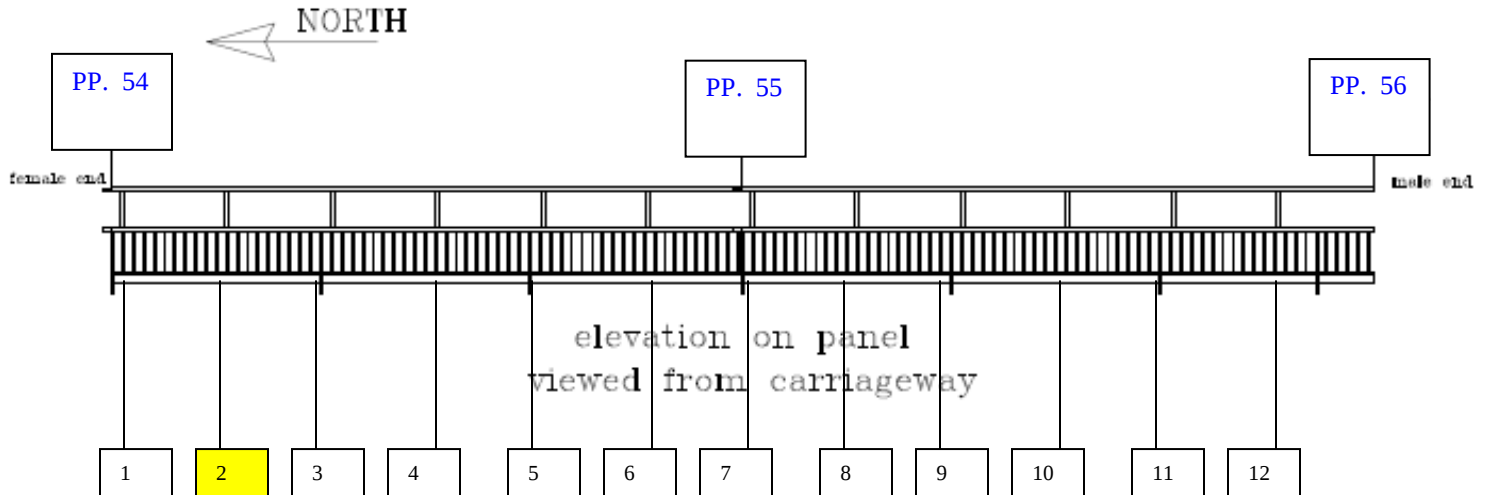

Relevant information:

Top Rail. – Plate washer for bolt required at PP54

Post No1.-

Post No2.- Bottom vertical weld cracked all the way round, previously plated, new plate required

Post No3.-

Post No4.-

Post No5.-

Post No6.-

Post No7.-

Post No8.-

Post No9.-

Post No10.-

Post No11.-

Post No12.-

Bottom Rail.- Crack on top surface, west and south faces at post 6

Grillage.-




INSPECTION DEPARTMENT

Main span North East. Crash
barrier / Handrail.

DATE. 2015.01.21

MAIN SPAN NORTH (EAST)

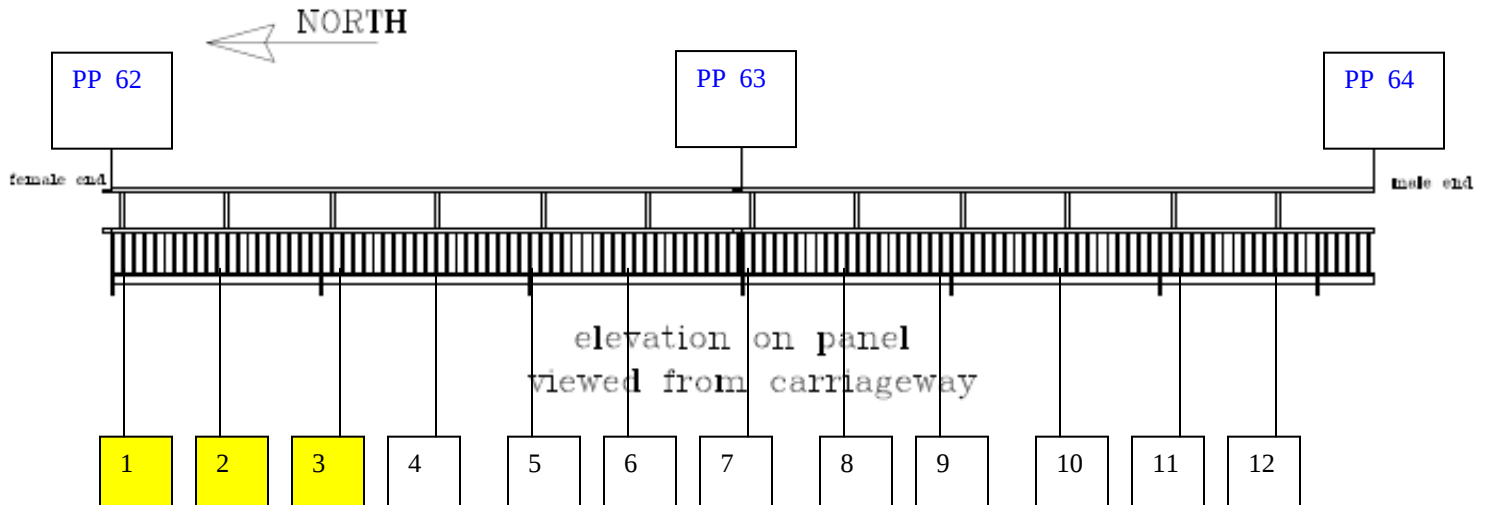


Relevant information:

Top Rail. – New top joint detail – plate washer required for bolt at PP62
Post No1.- Base weld broken all the way round – movement evident
Post No2.- Base welds cracked on west and south faces
Post No3.- Base weld cracked on east face
Post No4.-
Post No5.-
Post No6.-
Post No7.-
Post No8.-
Post No9.-
Post No10.-
Post No11.-
Post No12.-
Bottom Rail.-
Grillage.-



INSPECTION DEPARTMENT
Main span North East. Crash barrier / Handrail.
DATE. 2015.01.21

MAIN SPAN NORTH (EAST)

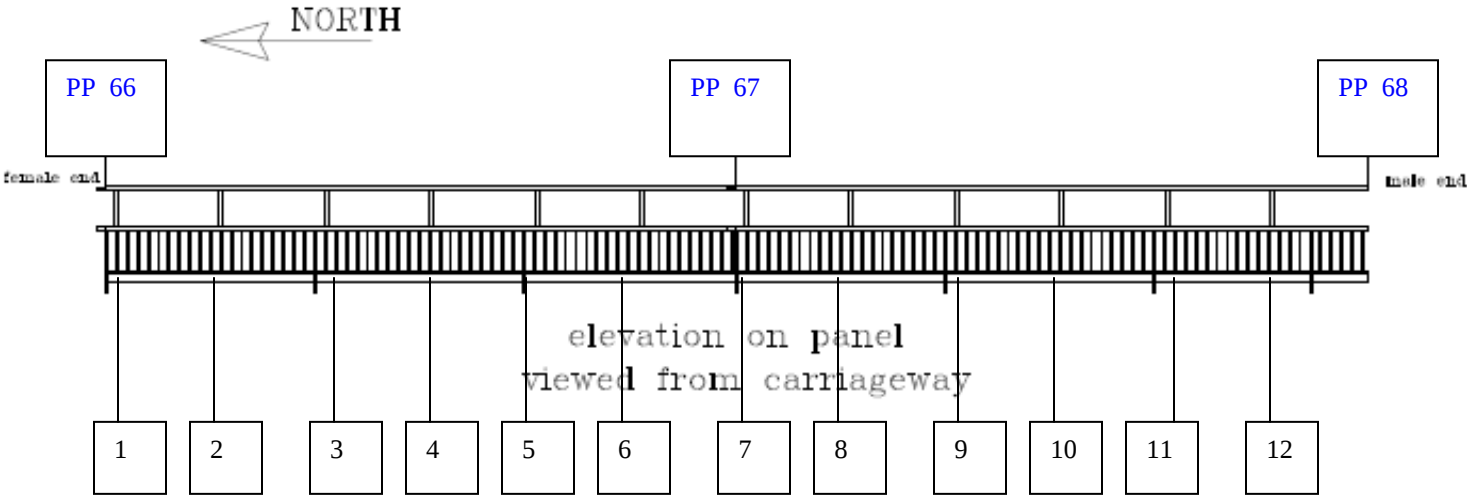


Relevant information:

- Top Rail. – New top rail detail, plate washer required for bolt at PP66
- Post No1.-
- Post No2.-
- Post No3.-
- Post No4.-
- Post No5.-
- Post No6.-
- Post No7.-
- Post No8.-
- Post No9.-
- Post No10.-
- Post No11.-
- Post No12.-
- Bottom Rail.-
- Grillage.-



INSPECTION DEPARTMENT
Main span North East. Crash barrier / Handrail.
DATE. 2015.01.21

MAIN SPAN NORTH (EAST)

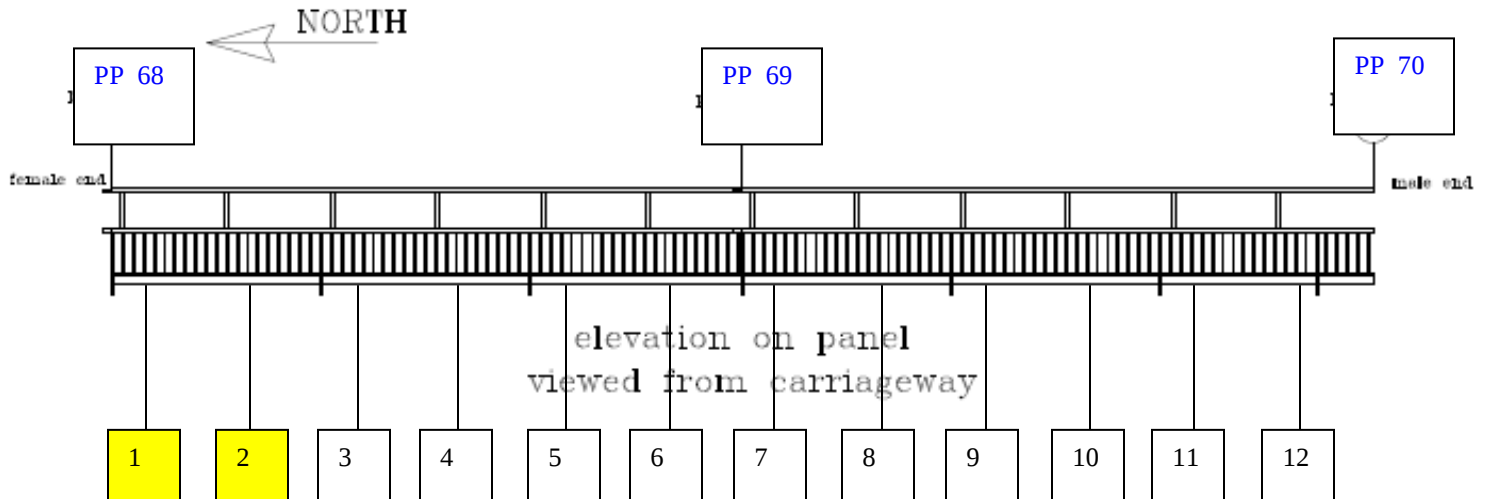


Relevant information:

Top Rail. – New top rail detail bolt pulled through at PP68, plate washer required for bolt at PP70
Post No1.- Base weld cracked on west face
Post No2.- Base welds cracked on east and west faces
Post No3.-
Post No4.-
Post No5.-
Post No6.-
Post No7.-
Post No8.-
Post No9.-
Post No10.-
Post No11.-
Post No12.-
Bottom Rail.-
Grillage.-



INSPECTION DEPARTMENT
Main span North East. Crash barrier / Handrail.
DATE. 2015.01.21

MAIN SPAN NORTH (EAST)

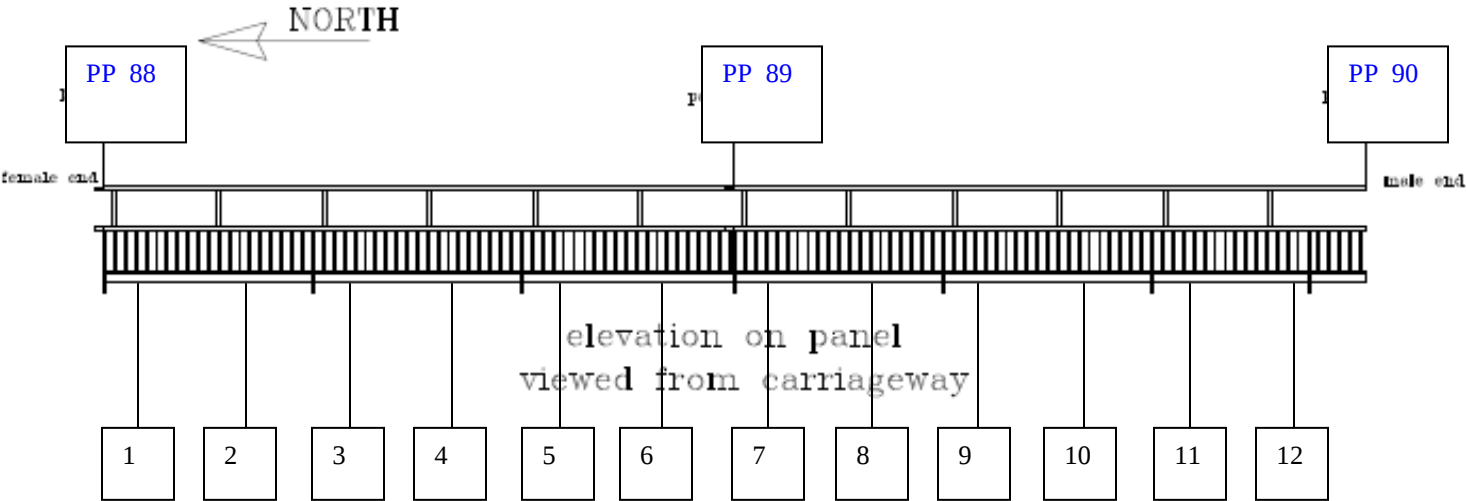

Relevant information:

- Top Rail. -
- Post No1.-
- Post No2.-
- Post No3.-
- Post No4.-
- Post No5.-
- Post No6.-
- Post No7.-
- Post No8.-
- Post No9.-
- Post No10.-
- Post No11.-
- Post No12.-
- Bottom Rail.- Corroded all the way round base of post 2, plate required
- Grillage.-




INSPECTION DEPARTMENT

Main span North East. Crash
barrier / Handrail.

DATE. 2015.01.21

MAIN SPAN NORTH (EAST)

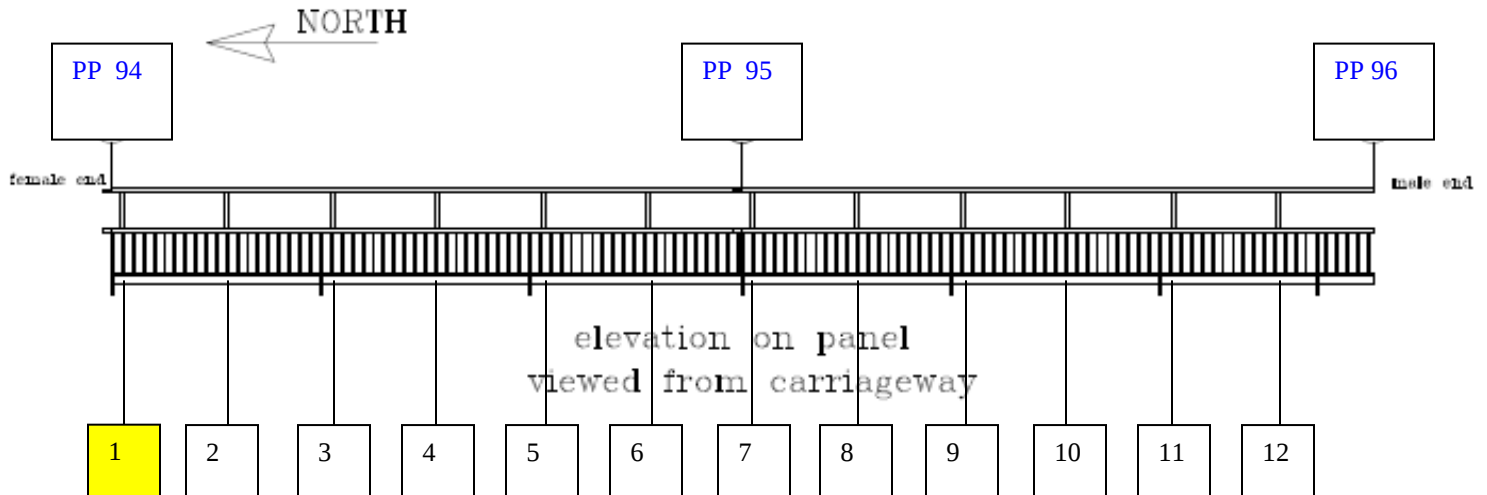

Relevant information:

Top Rail. – Possible top rail weld connection cracked at post 1, top surface and west face - check
Post No1.- Base welds cracked on west and south faces
Post No2.-
Post No3.-
Post No4.-
Post No5.-
Post No6.-
Post No7.-
Post No8.-
Post No9.-
Post No10.-
Post No11.-
Post No12.-
Bottom Rail.-
Grillage.-




INSPECTION DEPARTMENT

Main span North East. Crash
barrier / Handrail.

DATE. 2015.01.21

MAIN SPAN NORTH (EAST)

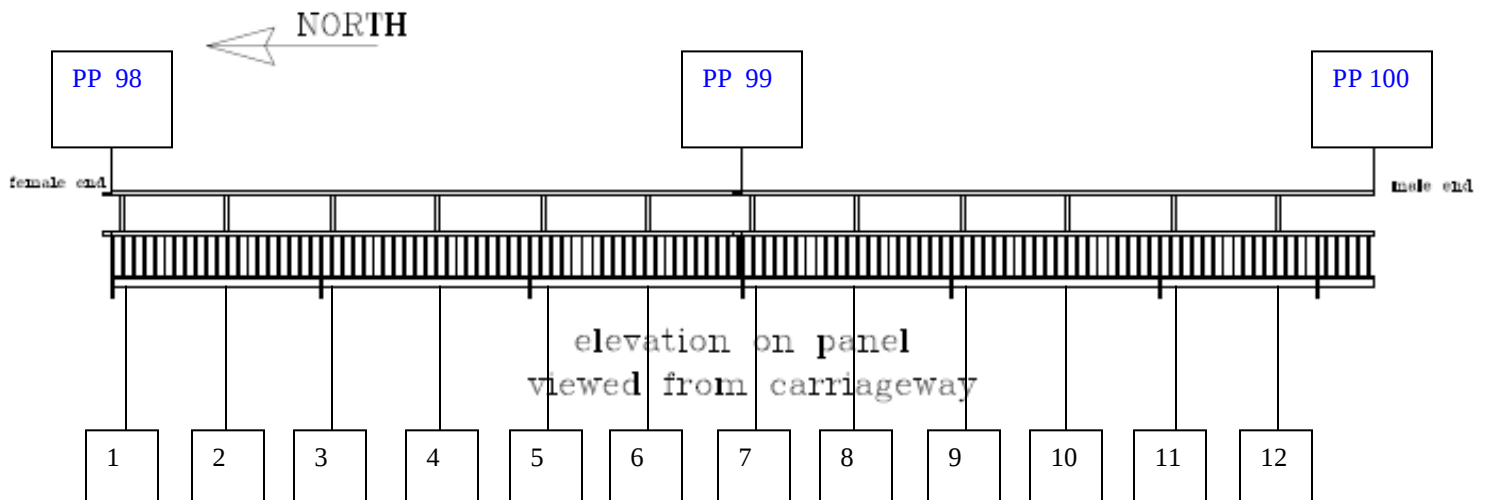

Relevant information:

Top Rail. – New top rail detail 1 no. counter sunk screw missing at PP98

Post No1.-

Post No2.-

Post No3.-

Post No4.-

Post No5.-

Post No6.-

Post No7.-

Post No8.-

Post No9.-

Post No10.-

Post No11.-

Post No12.-


Bottom Rail.-

Grillage.-



INSPECTION DEPARTMENT
Main span North East. Crash barrier / Handrail.
DATE. 2015.01.21

MAIN SPAN NORTH (EAST)

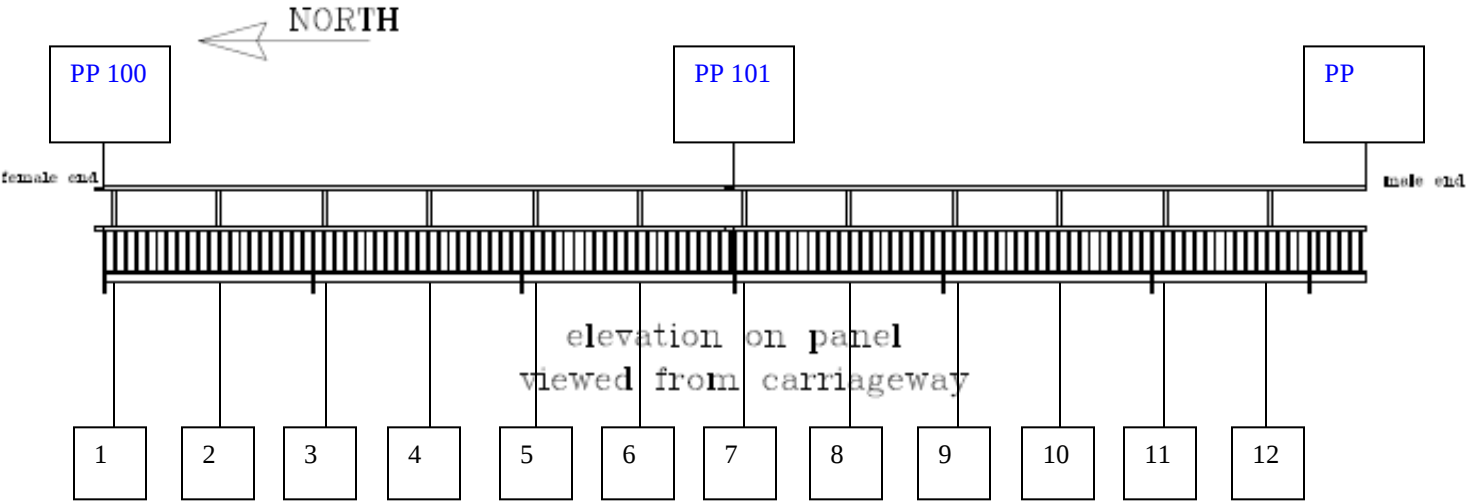

Relevant information:

- Top Rail. – New top rail detail 1 no. counter sunk screw missing at PP100
- Post No1.-
- Post No2.-
- Post No3.-
- Post No4.-
- Post No5.-
- Post No6.-
- Post No7.-
- Post No8.-
- Post No9.-
- Post No10.-
- Post No11.-
- Post No12.-
- Bottom Rail.-
- Grillage.-



INSPECTION DEPARTMENT
Main span North East. Crash barrier / Handrail.
DATE. 2015.01.21



INSPECTION DEPARTMENT
Main span North East. Crash barrier / Handrail.
DATE. 2015.01.21